




TYPICAL SECTION AT
REMOVED EXISTING WALL
¾" = 1'-0"

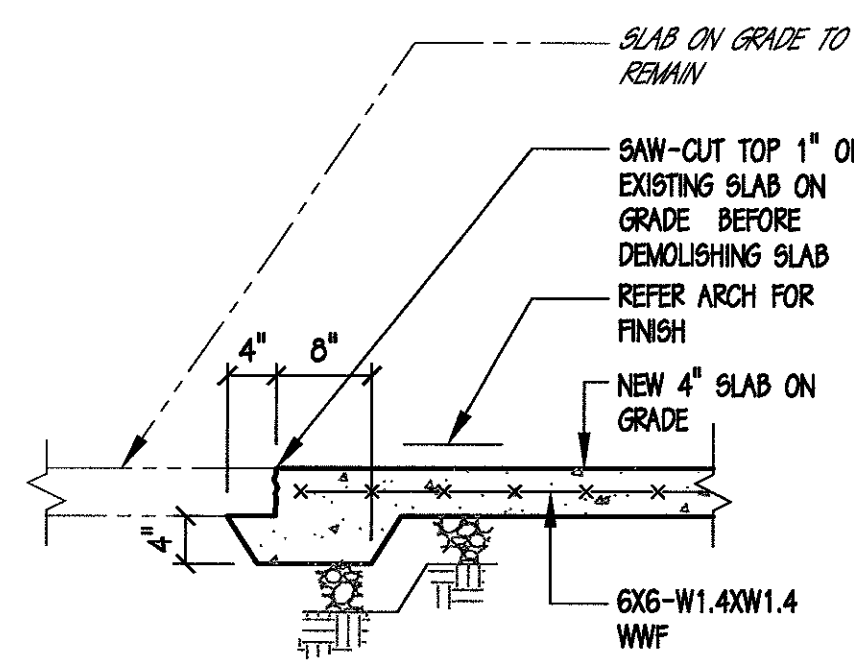


TYPICAL SLAB ON GRADE
REPAIR DETAIL

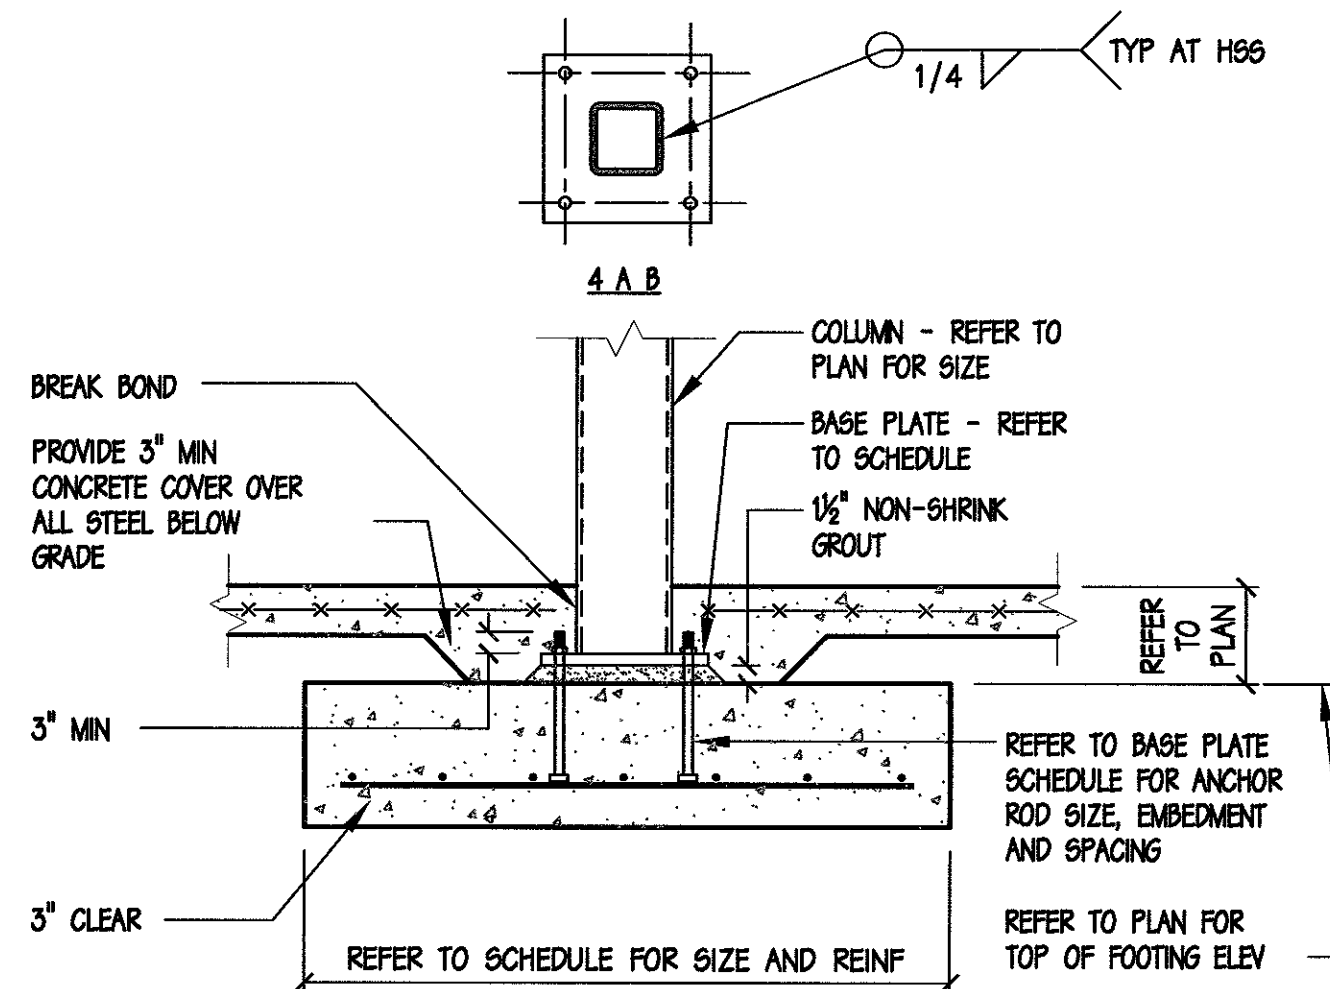

TYPICAL COLUMN FOOTING
¾" = 1'-0"

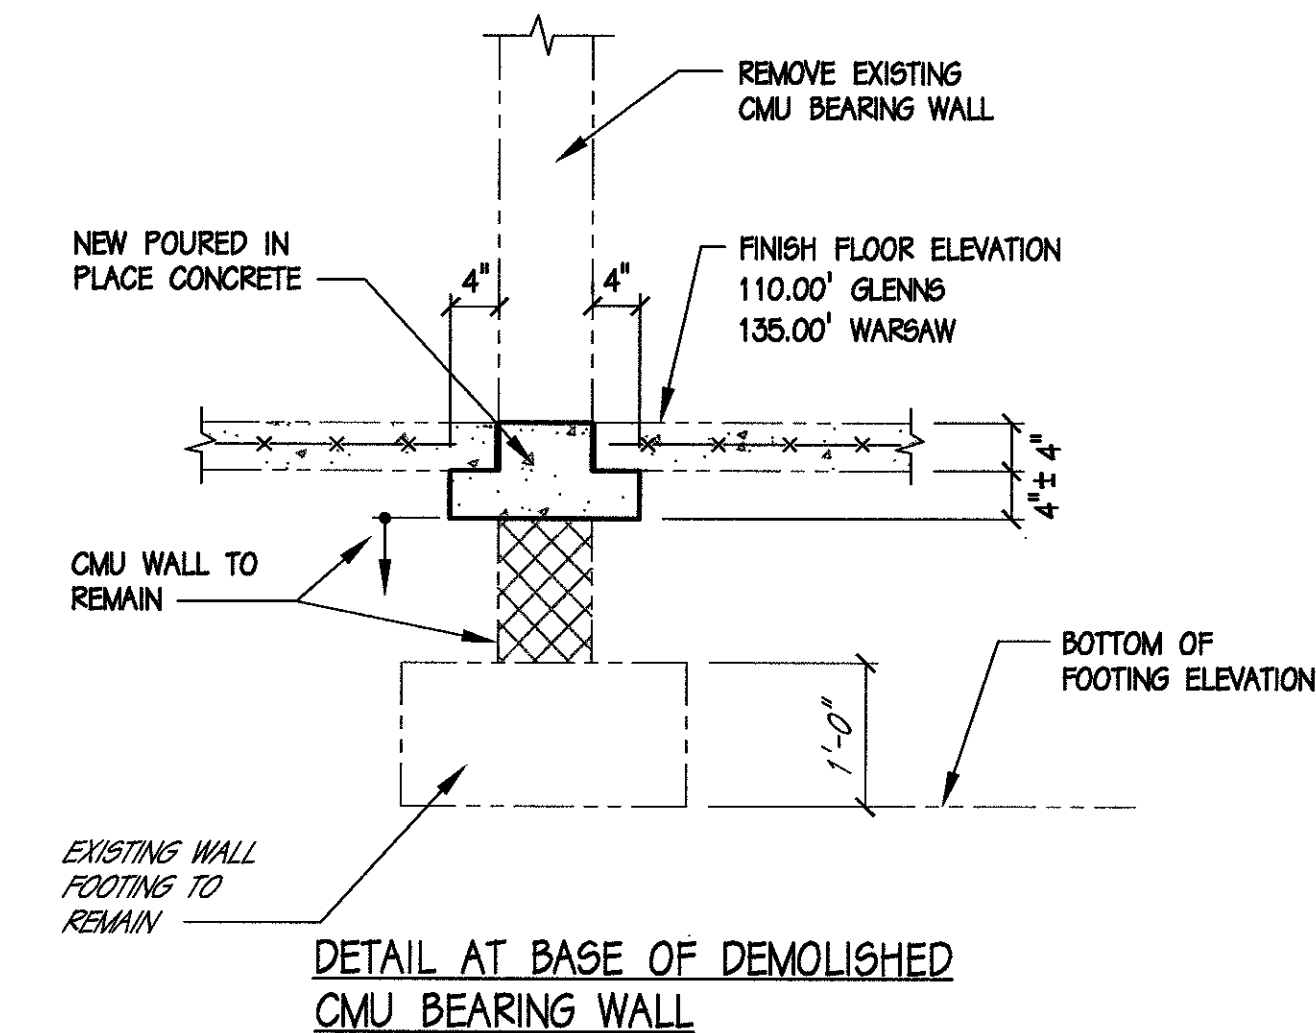


SECTION 1
¾" = 1'-0"

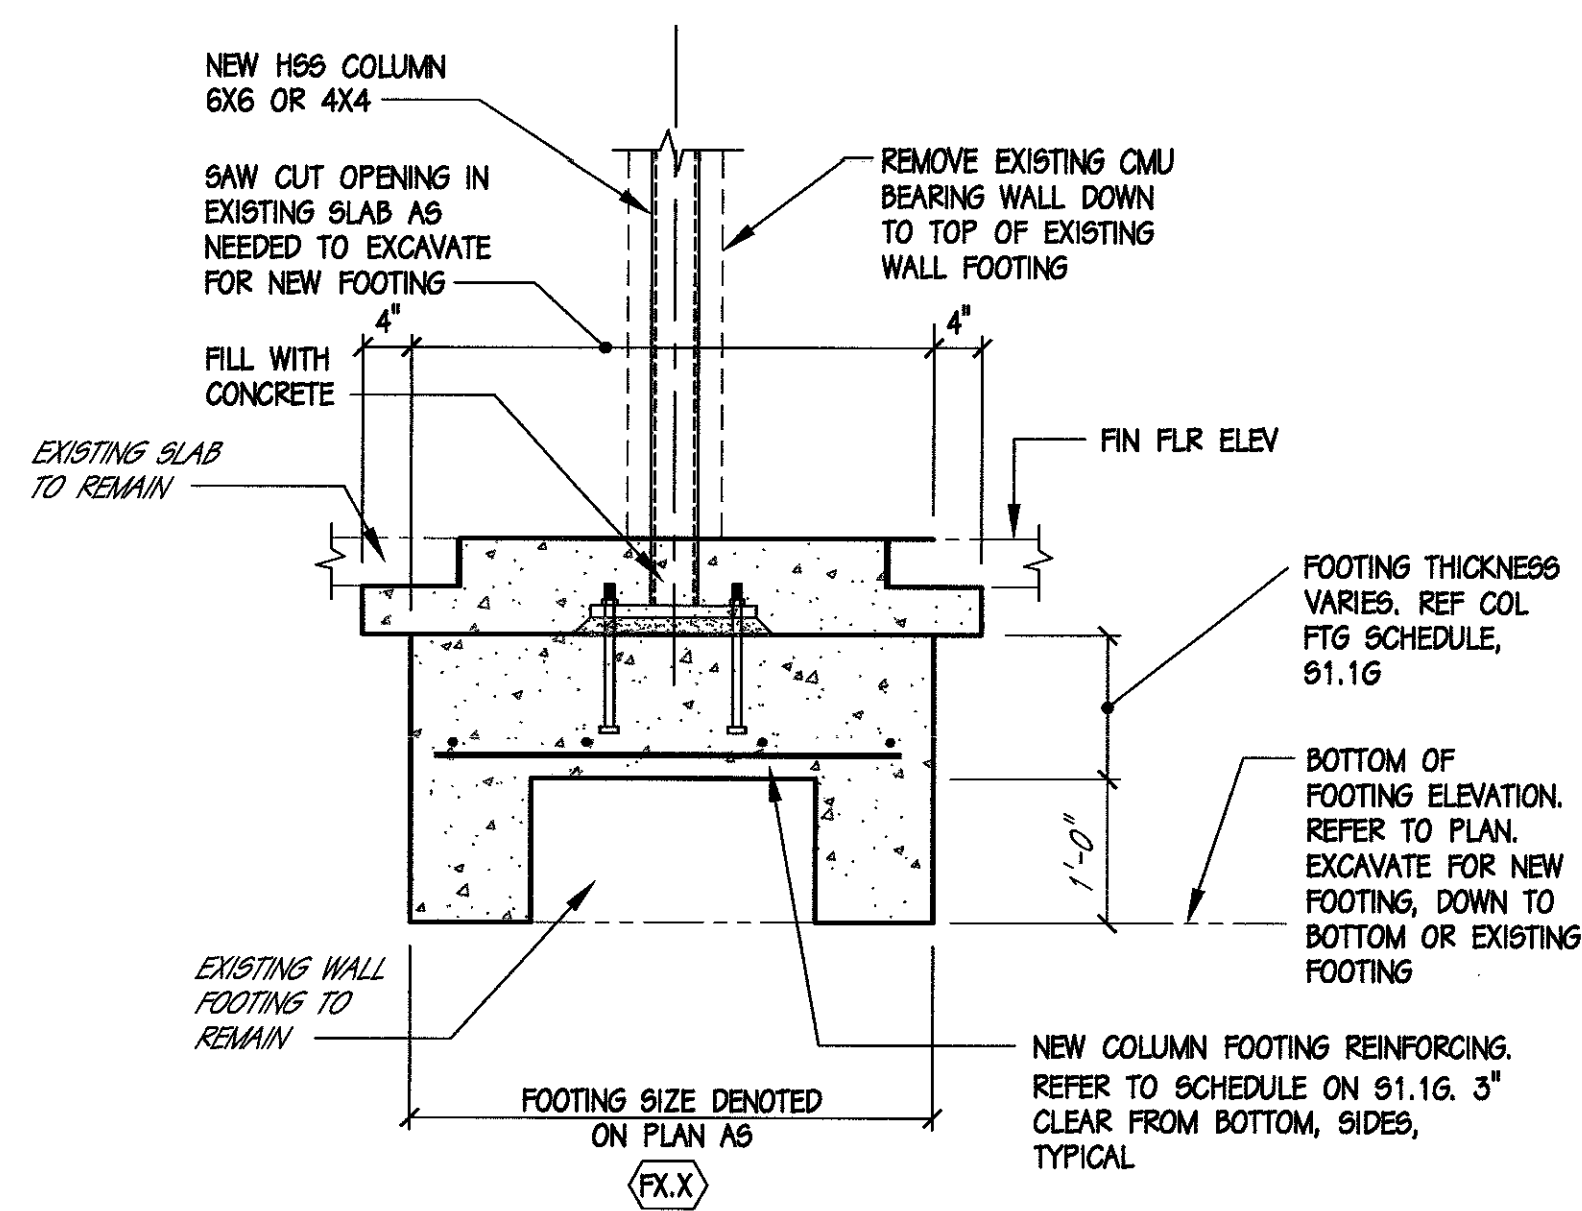


TYPICAL AT ALL NEW COLUMN
FOOTINGS WITHOUT A PIER UNLESS
NOTED OTHERWISE

SECTION 2
¾" = 1'-0"

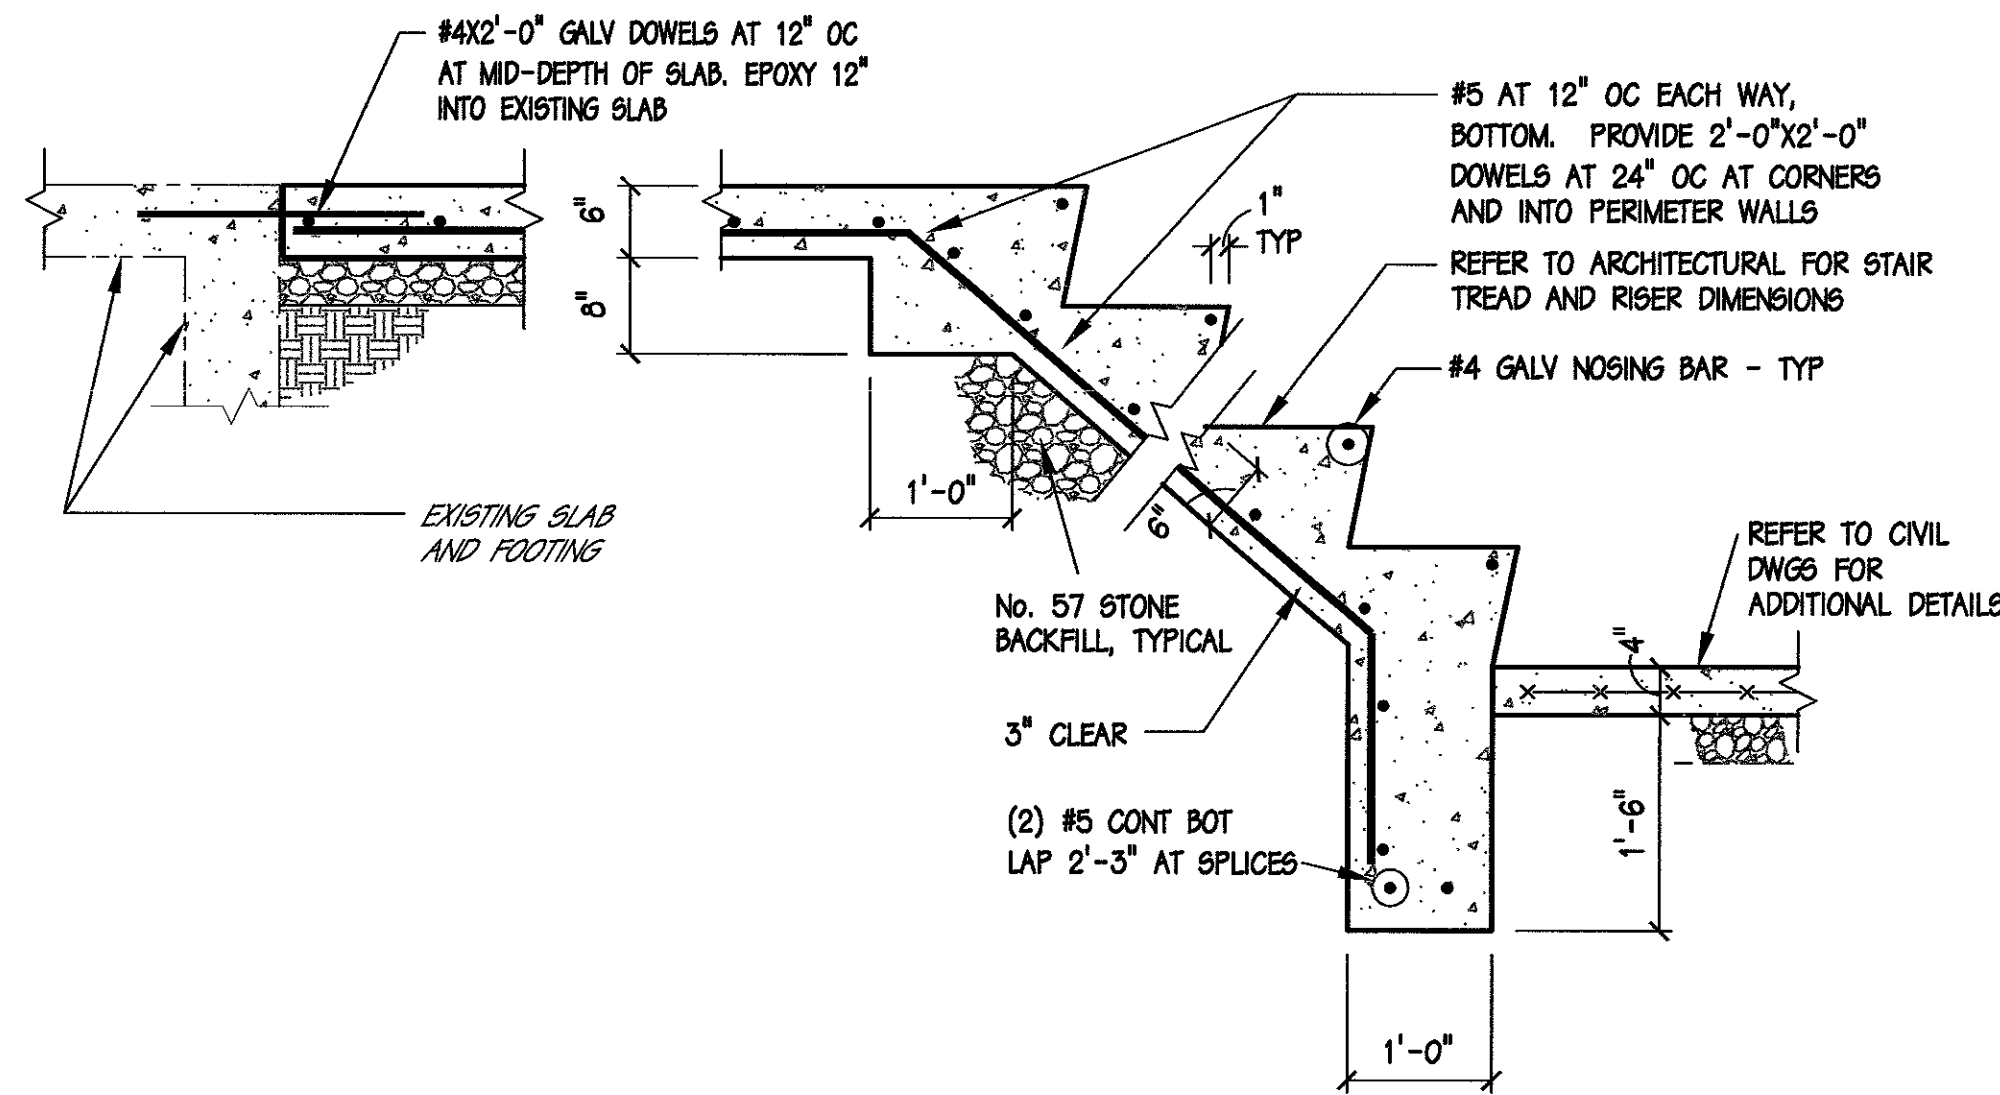

TYPICAL AT PERIMETER OF HANDICAP
RAMP ALL SIDES

SECTION 4
¾" = 1'-0"

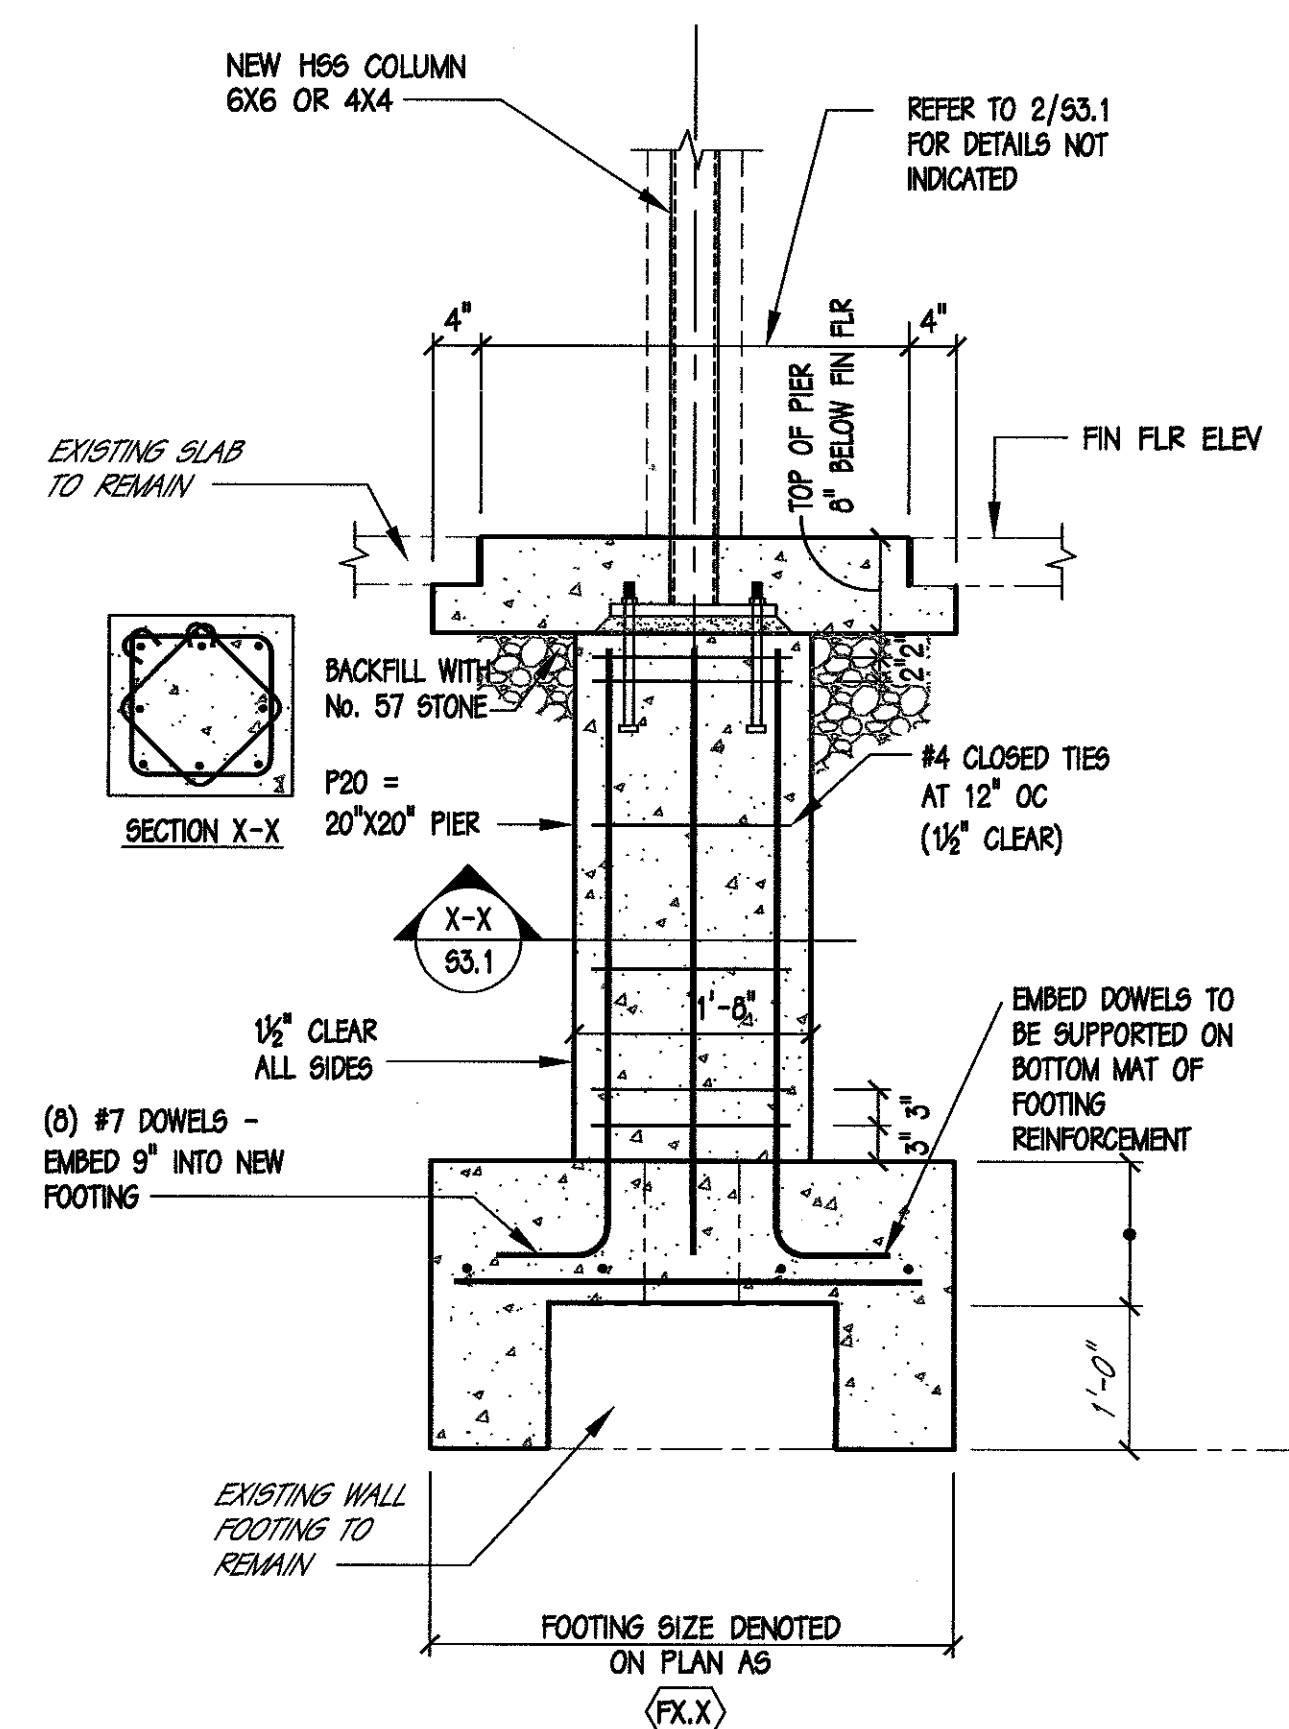

TYPICAL AT ALL NEW COLUMN FOOTING
WHERE PIER IS INDICATED

SECTION 5
¾" = 1'-0"

DUNBAR NILEY WILLIAMS
PITTMAN & VAUGHAN, PLLC
CONSULTING STRUCTURAL
ENGINEERS
730 HOOVERFIELD PARK DRIVE, SUITE 201
RICHMOND, VIRGINIA 23060
PHONE (804) 332-2400 FAX (804) 272-2916
PROJECT # 081037


mbj ARCHITECTURE
A Professional Limited Company
GROVE PARK SQUARE
11337-B NUCKOLS ROAD
Richmond, Virginia 23069
☎ (804) 273-9811 fax: (804) 273-9843

**RAPPAHANNOCK
COMMUNITY COLLEGE
CAMPUS RENOVATIONS
WARSAW + GLENN, VIRGINIA**
PC: 260-17712

TYPICAL FOUNDATION
SECTIONS
AND DETAILS

PERMIT
DRAWINGS

Date:	MAY 12, 2010
REVISIONS	
NO.	DATE

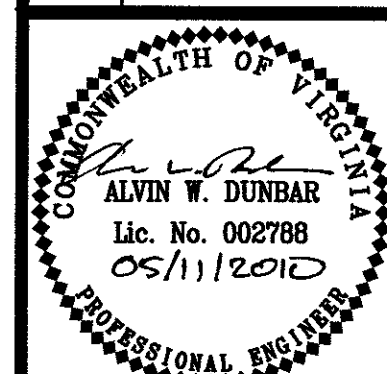

Sheet
S3.1
File Number